

Leland Limited, Inc South Plainfield, New Jersey 908-561-2000

Service Bulletin No. 11-60610

April 15, 2011

Models Affected: EMERGENCY STROBE LIGHT I, XENON
60610, 60610M, 60607, 60646M, 60646, 60647, 60647M

Background: Several customers have reported intermittent failures of the strobe module not firing. With a new battery inserted and the switch in the on position, the strobe should begin to fire (flash) within 2 seconds. Although no mechanical defect has been found, the following is a recommended self repair-adjustment to solve the issue.

Solution Steps:

1. Remove the lens, module and the battery
2. Look inside the battery compartment and identify two (2) brass contacts marked "A" and "B" in the picture.
3. Gently pry both contact "A" and "B" away from the body and toward the inside of the battery cavity.
4. Only move these contacts about 0.185", about 1/4 of an inch.
5. When you put the battery back in the unit be careful to clear these contacts.
6. Replace the module by touching the side of the module against these contacts first.
7. Reassemble the unit with the lens firmly in place.
8. Test function. If this does not resolve the issue, please contact us, 908-561-2000.

